

Work Order ID 131549

Tuesday, April 14, 2015 1:02:09 PM

131549

Item ID: D119-796-141

Accept

*N90

Revision ID:

Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 4/14/2015 Start Qty: 1.00

1

Cust Item

Required Date: 4/14/2015 Req'd Qty: 1.00

1

Customer

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____

QC: _____ Date: _____ SPC (Y/N): _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID
--------------------------------	--------------------------	----------------------	---------

250

250

Crosstubes

Crosstubes

0.00

Memo

0.00

Assemble as per Dwg D119-796-141

1- Abrade mating surfaces of support and crosstube with Scotch brite 7447 red, clean the area with Dupont 4105s or equivalent as per dwg

2- Install supports, clamp with the proper position with Proseal 890 per dwg D119-796-141 and QSI 015

A/R Proseal 890 Batch: 132226

EXP: 12/15

PROSEAL CURE TIME 72 HOURS:

Start: 15-6-17

Finish: 15-6-10

Torque all clamps to 80-100 IN-LBS.

Work Order ID 131549

Tuesday, April 14, 2015 1:02:09 PM

131549

Page 1

Item ID: D119-796-141

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: FWD Crosstube Installation without Step (no hardware)

Stop *NS2*

Start Date: 4/14/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/14/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLS Date: 15-04-14 Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start *NR1*

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D119-796-141	F

120

120

Packaging

Packaging

Memo

Packaging

0.00

0.00

130

130

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

Bend tube as per Dwg D119-796-141 using CNC bender program

0.00

0.00

140

140

QC

Quality Control

QC15- Crosstube Dimensional Check

Memo

0.00

0.00

TW 15-04-15

① 15-04-17

DAS

9

9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE /

QA Closed: _____ Date: _____

Work Order: _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐
Part No. _____		
NCR No. _____		

Date : _____ Step #: _____ QTY Effective _____

Description Work Order Deviation

--

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/U ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐				
Past Expiry Date ☐	Manufacturing Process ☐						
Misidentified ☐	Past Due ☐	OTHER : _____					

DQA: DA Date: 15/07/28

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: DA Date: 15/07/27Work Order update only ☐

Work Order: <u>131545</u>	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☒ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS					
Part No. <u>D119-796-141</u>		Skid-tube ☐	Cross tube ☒	Water Jet ☐	Engineering ☐		
NCR No. <u>15-5211</u>		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		

Date : 15.07.22 Step #: 250 QTY Effective : 0 MRB (QSI042) Approval IMP-12

Description Work Order Deviation

Right support is at 7.6° instead of 8.4°;
exceeds .5° tolerance.

R.C. not verifying work (operator)

Disposition

Acceptable.

No effect on function

Completed By

DAS
41 15-6-19
9-89Lead hand / Supervisor
Approval VerificationDAS
9 15.07.22
9-89QC / QA Coordinator
ApprovalDAS
9 15.07.22
9-89

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☒		
Design ☐	Operator ☒	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐						
Misidentified ☐	Past Due ☐	OTHER : _____					

Work Order ID 131549

Tuesday, April 14, 2015 1:02:09 PM

131549

Page 10

Item ID: D119-796-141 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: FWD Crosstube Installation without Step (no hardware)
Start Date: 4/14/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/14/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	QC5- Inspect part completeness to step on W/O	0.00							DAS 38 9-89
260						1			
QC	Memo	0.00							
Quality Control	***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED AS PER DWG.***								15-04-29
270	Pick Kit	0.00							
270									
Packaging	Memo	0.00							
Packaging									
280	QC4- 100% Inspect kits for completeness	0.00							
280									
QC	Memo	0.00							
Quality Control									

N/A
AS-7-22

N/A MJS
JUL 22 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 131549

131549

Page 11

Tuesday, April 14, 2015 1:02:09 PM

Item ID: D119-796-141 Accept *N900040100* Setup Start *NS1*
Revision ID: Stop *NS2*
Item Name: FWD Crosstube Installation without Step (no hardware)
Start Date: 4/14/2015 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 4/14/2015 Req'd Qty: 1.00 *1* Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
290	Packaging	0.00							
290	Packaging	0.00	w/o USED			①	②	151	
Packaging	Memo		on 133188				SAD	22/07/15	
	Identify and pack for shipping as per PPP D119-796-141								
300	QC21- Final Inspection - Work Order Release	0.00							
300	QC	0.00							
Quality Control	Memo								

MS JUL 22 2015
① S-7-22

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																		
Large Fab ☐	Composite ☐	Supplier ☐																			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																	
Description Work Order Deviation			Disposition																		
						Completed By															
						Lead hand / Supervisor Approval Verification															
			QC / QA Coordinator Approval																		
Root Cause		FAULT CATEGORY																			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																
OTHER : _____																					

Picklist Print

Tuesday, April 14, 2015 1:02:12 PM

Page 1

Work Order ID: 131549

131549

Parent Item: D119-796-141

D119-796-141

Parent Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 4/14/2015

Required Date: 4/14/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 14.09.03 NEW ISSUE DD VERF:JLM IPP
REV:B 14.10.15 AS PER REV.B DD VERF:JLM IPP REV:C
14.11.19 AS PER REV.C DD VERF:JLM IPP REV:D 14.12.12
AS PER REV.pd1 DD VERF:JLM IPP REV:E 15.02.11 AS PER
REV F JLM VERIFIED BY:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D119-796-141TRN

Manufactured No

Each 0.0000

1

D119-796-141TRN

Crosstube Turning Detail

131 305

**

11

PL 15/04/15

D2873-043

Manufactured No

Each 58.0000

4

D2873-043

Nut Plate Assembly

**

AB 15-6-7

Location

Loc Qty

Loc Code

LG

40

128814

40

LG052

18

127801

2

129732

16

Each

32.0000

4

D5123-3

Manufactured No

D5123-3

Clamp Cushion

**

CR 15-06-7

Location

Loc Qty

Loc Code

lg55

32

126747

24

127133

6

131009

2

131 410

4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐																			

Picklist Print

Tuesday, April 14, 2015 1:02:13 PM

Page 2

Work Order ID: 131549

131549

Parent Item: D119-796-141

D119-796-141

Parent Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 4/14/2015

Required Date: 4/14/2015

Start Qty: 1.00

Required Qty: 1.00

D5124-1 Manufactured No

Each 8.0000 2

D5124-1

Fwd Support

CN 13-06-7

2

Location Loc Qty Loc Code

LG055 8

126749 8

Each 6.0000 2

D5152-041 Manufactured No

D5152-041

Fwd Post Mount Assembly

CN 15-05-10

2

Location Loc Qty Loc Code

LG054 4

131108 4

LG055 2

130028 2

Each 171.0000 16

CR3212-4-07 Purchased No

CR3212-4-07

CHERRY RIVET

AB 15-6-10

16

Location Loc Qty Loc Code

ST320 171

m131317 36

m131800 135

Each 50.0000 4

MS21920-24 Purchased No

MS21920-24

Clamp

CN 15-06-7

4

Location Loc Qty Loc Code

FG 2

117998 2

LG050 48

108258 1

120079 1

m129317 46

Tuesday, April 14, 2015 1:02:13 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

DART AEROSPACE LTD		Work Order: 131549
Description:		Part Number:
Inspection Dwg:	Rev:	Page 1 of 1

Required Dimension	Min	Max
Height	21.419	21.75
1/2 Span	39.82	40.08
Angle	54.64	54.78
Total Span	79.64	80.16
Bending Passes	8	
Crushing	1	6.80%

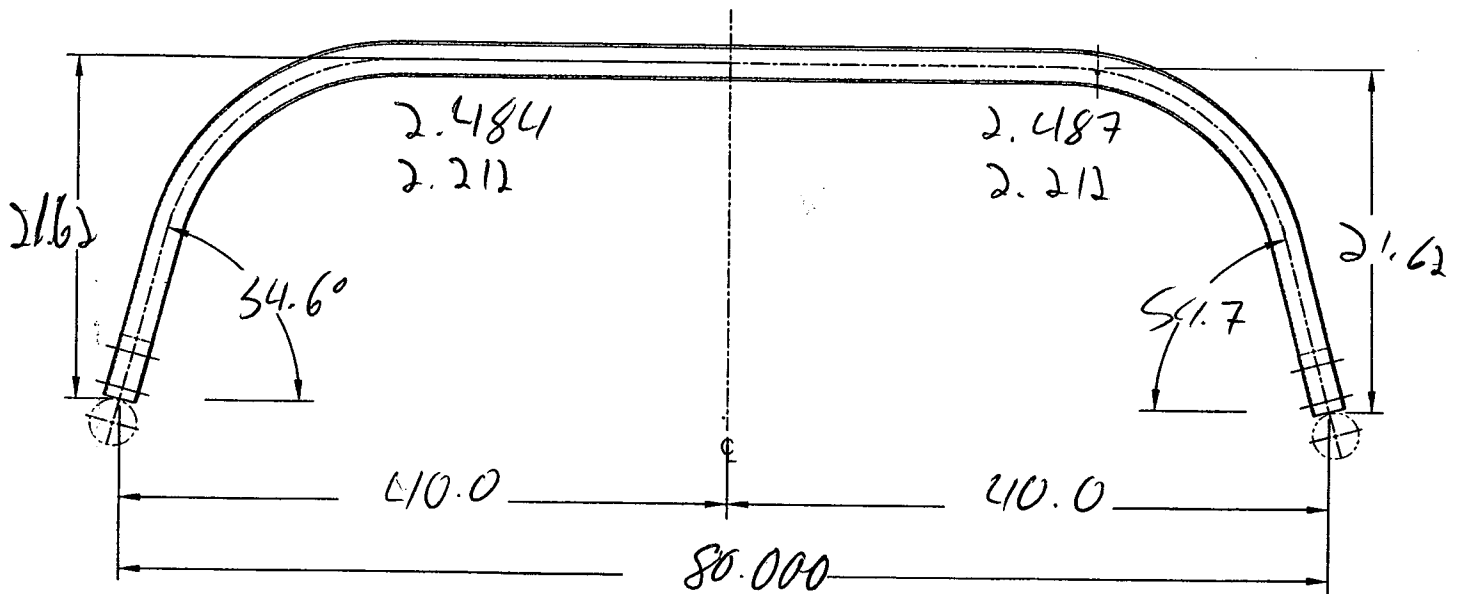

	Side A	Side B
Bending Passes	8	8
Crushing	5.80%	5.9%
Comments		

DAS	
QC15 Inspection	9
Date	15.04.17

Rev	Date	Change	Revised by	Approved
A		New Issue		
B	06.09.19	Reformat; QC level revised	KJ/JM	
C	07.02.06	Reformat	KJ/JM	
D	12.02.15	Added bending passes and crushing	KJ	
E	12.03.07	Revised comments table	KJ	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-141	XTUBE ASSY (AW119 MKII FWD)
1	1	D119-796-141BND	CROSSTUBE, FWD
2	4	D2873-043	RADIUS BLOCK
3	4	D5123-3	CLAMP CUSHION
4	2	D5124-1	FWD SUPPORT
5	2	D5152-041	FWD POST MOUNT ASSY
6	16	CR3212-4-07	RIVET, BLIND CSK
7	4	MS21920-24	CLAMP

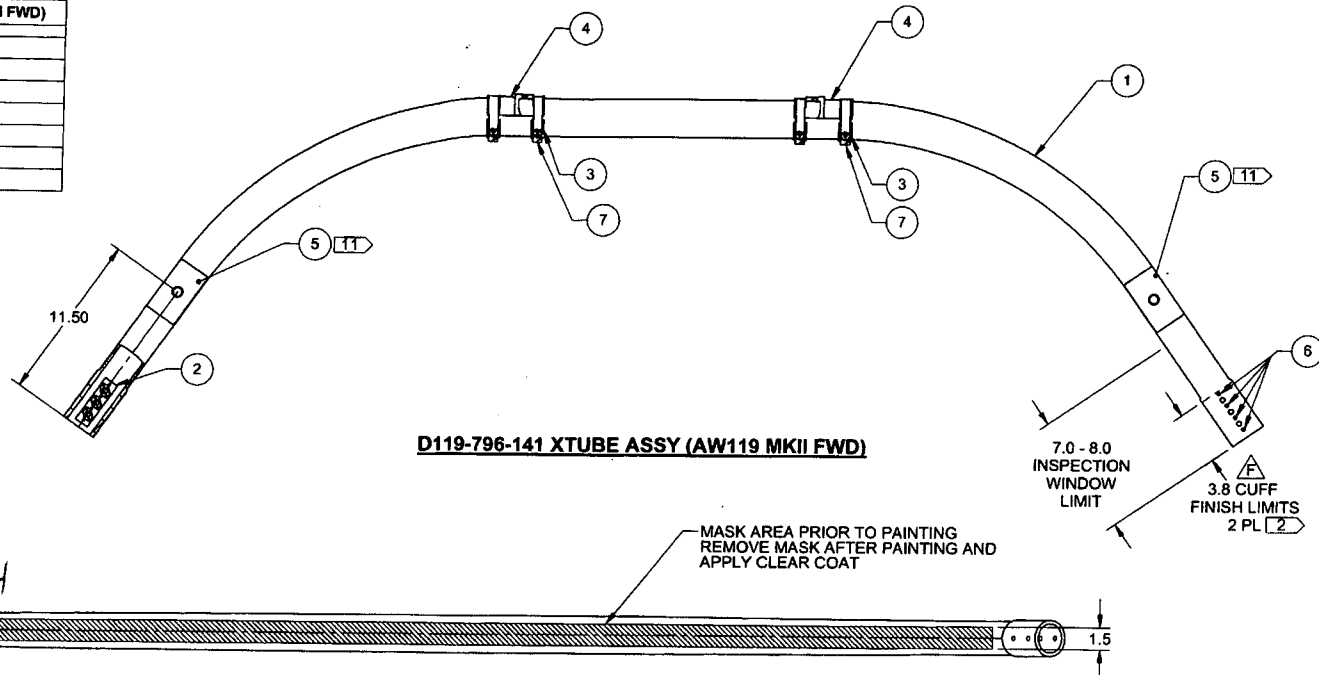

D119-796-141 XTUBE ASSY (AW119 MKII FWD)

131549 MLC
15-04-14

RELEASED

2015 FEB 09

ECN 15-526 UP

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: MASK UNDERSIDE OF CROSSTUBE AS SHOWN (B3-1, HATCHED AREA), PAINT OUTSIDE PER DART QSI 005 4.2 REMOVE MASKING AND APPLY MATTE CLEAR COAT DO NOT APPLY FINISH (PAINT OR CLEAR COAT) TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-141" AND BATCH NUMBER ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 18.43 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) AFTER FINISHING, ABRASE MATING SURFACES OF D5124-1 FWD SUPPORTS AND CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH'N'WIPE DEGREASER. APPLY A 0.100 MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5124-1 FWD SUPPORTS AND INSTALL AT AN 8.4° OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL THE MS21920-24 CLAMPS AND D5123-3 CLAMP CUSHIONS WHILE WET.
- 10) TORQUE MS21920 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY, THE NUT IS FACING AFT AND HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-041 WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH'N'WIPE DEGREASER. INSTALL D5152-041 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.100 MIN THK. LOCATE D5152-041 USING TOOL DT10089.

F	REMOVED PRIME/ PAINT ON CUFFS, 2.516 WAS 2.500 (C8-S)	AP	15.02.03
E	D5152-041 FWD STEP POST ASSY WAS D5150-1 STEP POST, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER, ANGLE (B7-2) DIMENSIONED FROM NEW DATUM	DB	15.01.15
D	ADD D5150-1 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHEET 1, MODIFIED NOTES ON SHT 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WERE CR3212-4-09, 7.5 DEG CUFF ANGLE OFFSET REMOVED (SHT 3), CUFF DIAMETER ON D119-796-141TRN REDUCED TO 2.500, ADDED INSPECTION WINDOW (B7-3), ADDED SHT 4	AP	14.10.23
B	ADDED D2873-043 RADIUS BLOCK, CR3212-4-09 RIVETS, ADDED SKIDTUBE REFERENCE FOR LOCATING CUFF HOLES, RE-ORGANIZED NOTES AND REMOVED REDUNDANT INFORMATION	AP	14.09.02
A	NEW ISSUE	AP	14.08.09
REV.	DESCRIPTION	BY	DATE
DESIGN	AP		
DRAWN	AP		
CHECKED	AJS		
MFG. APPR.	JLM		
APPROVED	HS		
DE APPR.	DS		
DATE	15.02.03		

APPROVED

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA


DRAWING NO.
D119-796-141

REV. F
SHEET 1 OF 6


TITLE
XTUBE ASSY (AW119 MKII FWD)

SCALE
NTS


COPYRIGHT © 2014 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE COPIED FOR ANY PURPOSE, OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

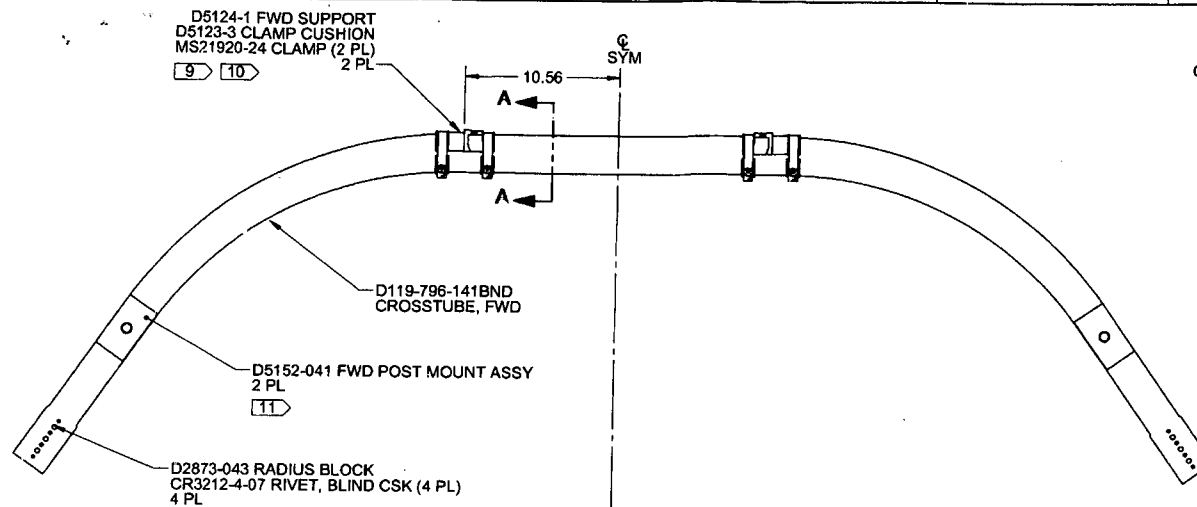

D119-796-141 XTUBE ASSY (AW119 MKII FWD)

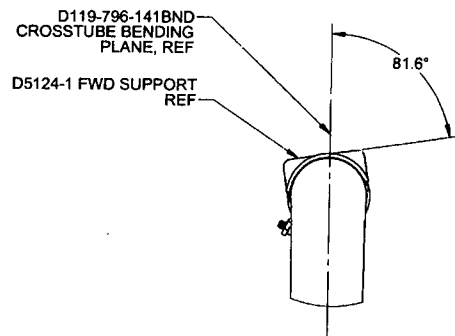

DETAIL B
SCALE 2X

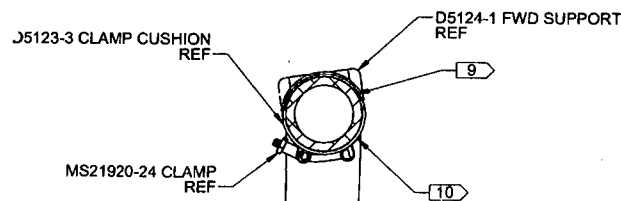


SECTION A-A
SCALE 2X

RELEASED

2015 FEB 09

APPROVED	DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
	DRAWN	AP		
	CHECKED	AJS	DRAWING NO.	REV. F
	MFG. APPR.	JLM	D119-796-141	SHEET 2 OF 6
	APPROVED	HS	TITLE	SCALE
	DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE		15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

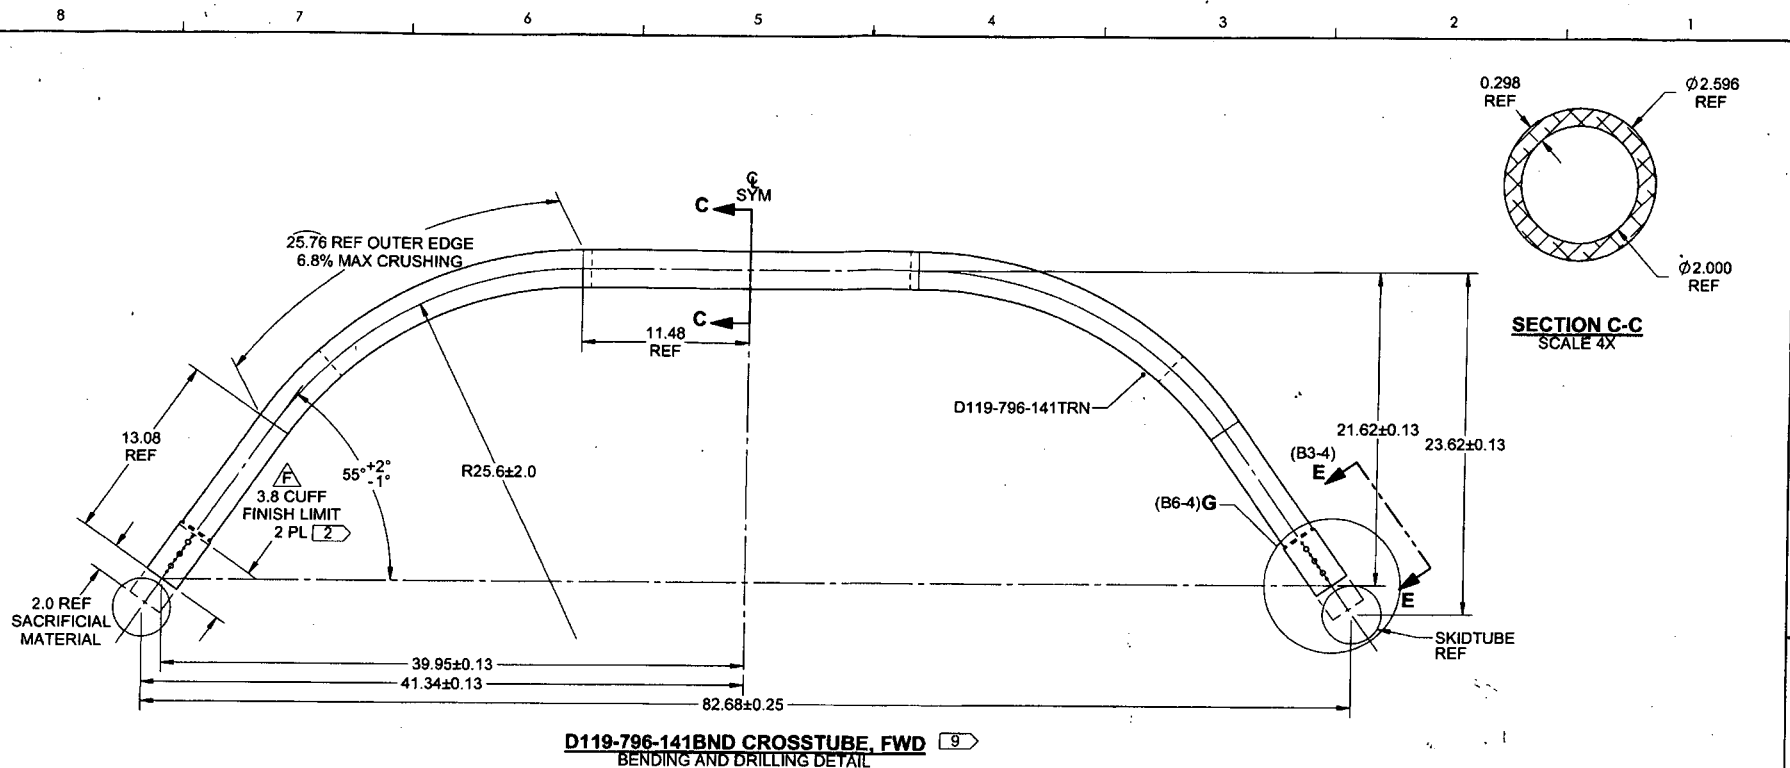

NOTES:


- 1) MATERIAL: MADE FROM D119-796-141TRN
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
DO NOT APPLY PRIMER TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 16.70 lbs
- 8) PART IS SYMMETRICAL ABOUT CENTERLINE
- 9) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6.8% BASED ON OD.
- 10) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

RELEASED


2015 FEB 09

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-141	SHEET 3 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

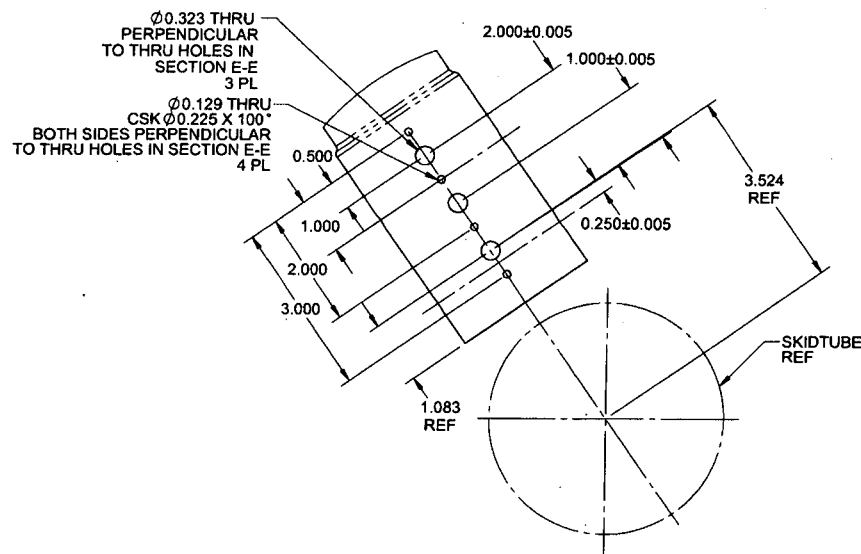

DETAIL G (C2-3)
SCALE 4X

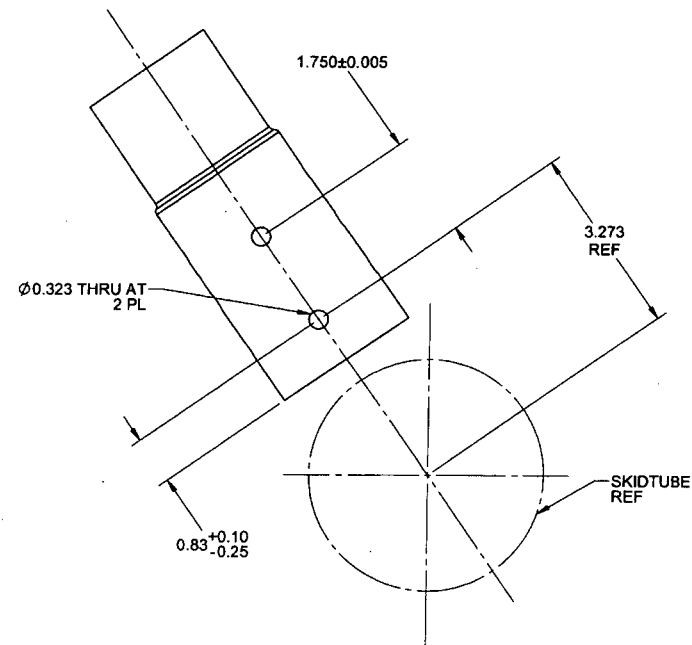


SECTION E-E (C2-3)
SCALE 2X


RELEASED

2015 FEB 09

APPROVED	DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
	DRAWN	AP		
	CHECKED	AJS	DRAWING NO.	REV. F
	MFG. APPR.	JLM	D119-796-141	SHEET 4 OF 6
	APPROVED	HS	TITLE	SCALE
	DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
	DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

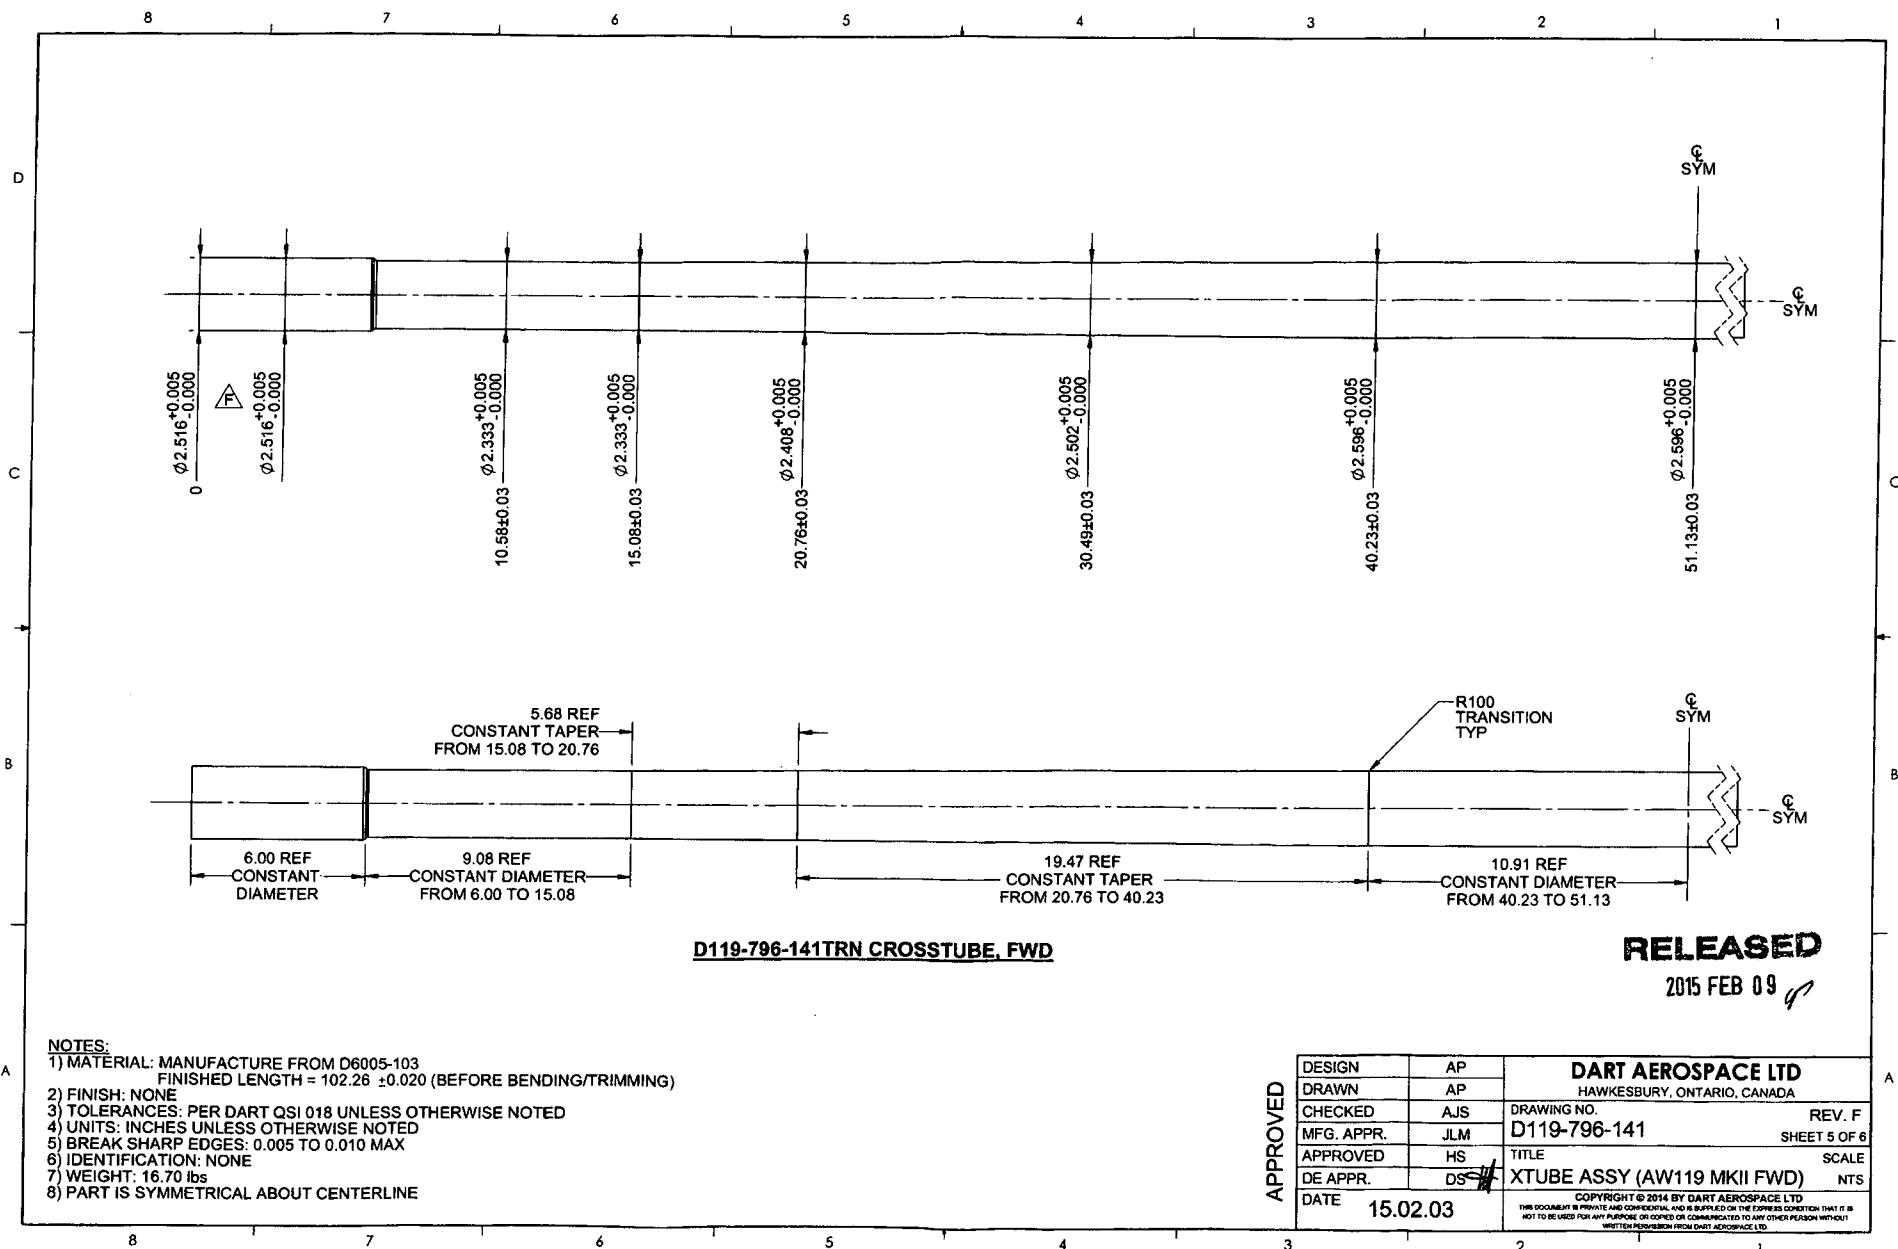

D119-796-141TRN CROSSTUBE, FWD
 AUXILIARY VIEW: NOMINAL WALL THICKNESS

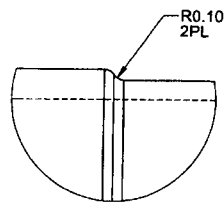

DETAIL G
 SCALE 2X

CHAMFER ID
 AS REQUIRED
 FOR TOOLING

0.258 REF
 NOMINAL WALL

0.167 REF
 NOMINAL WALL
 10.58±0.03

0.167 REF
 NOMINAL WALL
 15.08±0.03

0.204 REF
 NOMINAL WALL
 20.76±0.03

0.251 REF
 NOMINAL WALL
 30.49±0.03

0.298 REF
 NOMINAL WALL
 40.23±0.03

0.298 REF
 NOMINAL WALL
 51.13±0.03

RELEASED

2015 FEB 09

APPROVED	DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
	DRAWN	AP		
	CHECKED	AJS	DRAWING NO.	REV. F
	MFG. APPR.	JLM	D119-796-141	SHEET 6 OF 6
	APPROVED	HS	TITLE	SCALE
	DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE		15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO28279**

Purchase Order Date 4/27/2015

PO Print Date 4/29/2015

Page Number 3 of 6

Order From :

VC-SKY001

Ship To : DART AEROSPACE LTD

SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name

Vendor Phone

905-678-5636

Ship To Contact

Ship To Phone

Ship Via:

Delivered

Ship Acct:

Buyer

Chantal Lavoie

Customer POID

Customer Tax #

10127-2607

Terms

Net 30

Currency

CAD

FOB

FCA - (Free Carrier)

Line Total: \$110.00

6	131548	D119-796-141 CROSSTUBE	4/29/2015	1.00	\$110.00	\$110.00
---	--------	---------------------------	-----------	------	----------	----------

Yes

4/29/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$110.00

7	131549	D119-796-141 CROSSTUBE	4/29/2015	1.00	\$110.00	\$110.00
---	--------	---------------------------	-----------	------	----------	----------

Yes

4/29/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

SP15-04-29

Line Total: \$110.00

8	131550	D119-796-241 CROSSTUBE	4/29/2015	1.00	\$110.00	\$110.00
---	--------	---------------------------	-----------	------	----------	----------

Yes

4/29/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Note:

4/29/2015



skyservice Work Order Traveler

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO24373	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: 28279
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT INSPECTION (LIQUID PENETRANT) ON 12 CROSSTUBES

ITEM ID: D119-796-241 AFT CROSSTUBE INSTALLATION WITHOUT STEP (NO HARDWARE)

- 1 - WORK ORDER ID#: 131550
- 2 - WORK ORDER ID#: 131551
- 3 - WORK ORDER ID#: 131552
- 4 - WORK ORDER ID#: 131553
- 5 - WORK ORDER ID#: 131554
- 6 - WORK ORDER ID#: 131555

ITEM ID: D119-796-141 FWD CROSSTUBE, STD W/O PEG STEPS (MKII)

- 7 - WORK ORDER ID#: 131077
- 8 - WORK ORDER ID#: 131543
- 9 - WORK ORDER ID#: 131544
- 10 - WORK ORDER ID#: 131547
- 11 - WORK ORDER ID#: 131548
- 12 - WORK ORDER ID#: 131549

SP15-04-29

Action Taken:		Date:	Initial/Stamp:
LIQUID PENETRANT INSPECTION CARRIED OUT ON ITEMS LISTED ABOVE (ITEMS 1-12) AS PER ASTM1417M-13		APR 28 2015	
NO CRACK FOUND			
Pen: ZL-56 BATCH# 09H094 EXP. DATE: DEC 2017, DEV: SKD-S2 EXP. DATE: OCT2017 CLEANER: SKC-S EXP. DATE: APR 2018			
Description	Location P/N	Qty	Batch S/N Off S/N On
	DAS		
	36		
	9-89		
	APR 29 2015		

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature:		ACA/SCA Stamp	Date:
Name:	ANTONINO MARCHETTA		APR 28 2015